




Processor of why! W253EU replace (German)

Processor (CPU) Intel 3210m replace.

Written By: Felice Suglia




Step 1 — battery pack

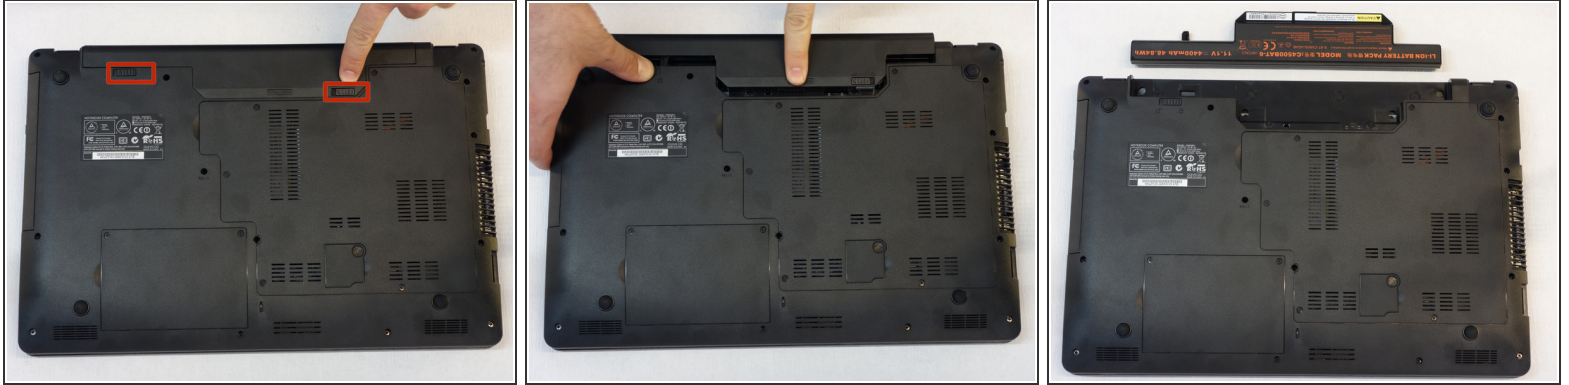


- off computer.
- Before each handle, it is important to start the expansion of the accumulator.
- bring in unlocked position slider Removing the battery.

Step 2 — Access to RAM memory and CPU

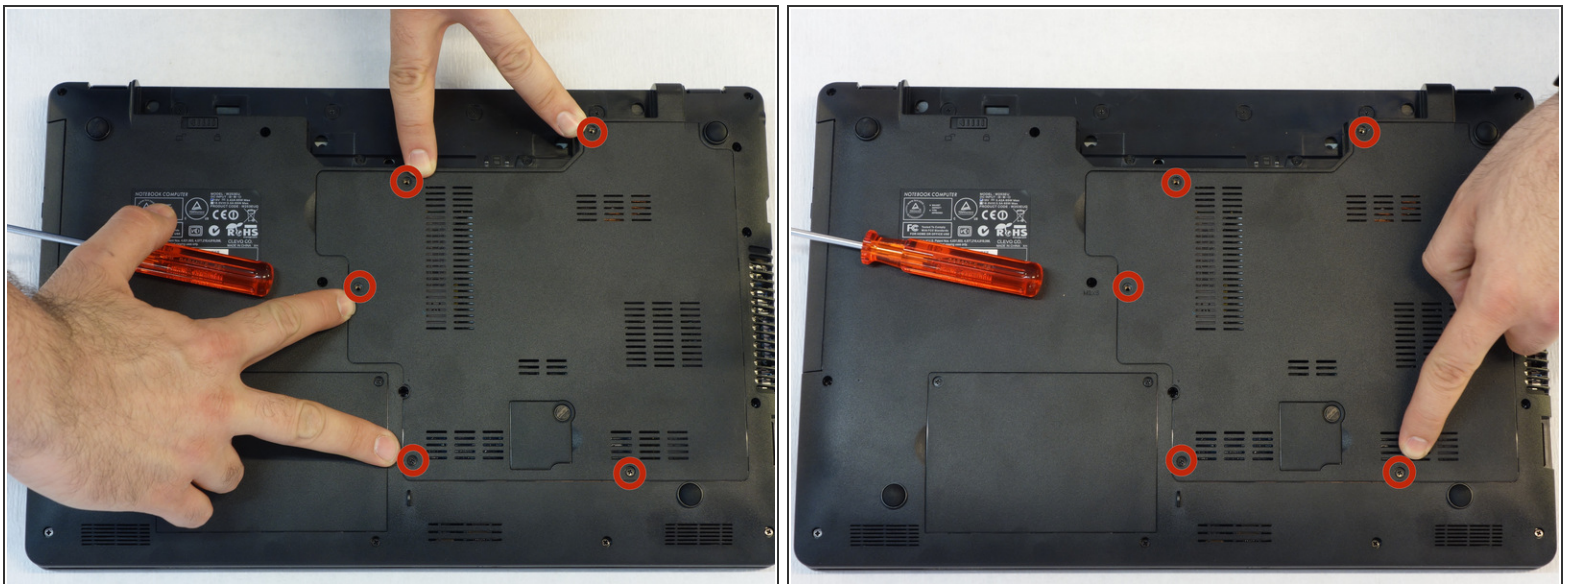


- With the screwdriver Philips # 1, screw the 5 screws securing the cover off.

Step 3

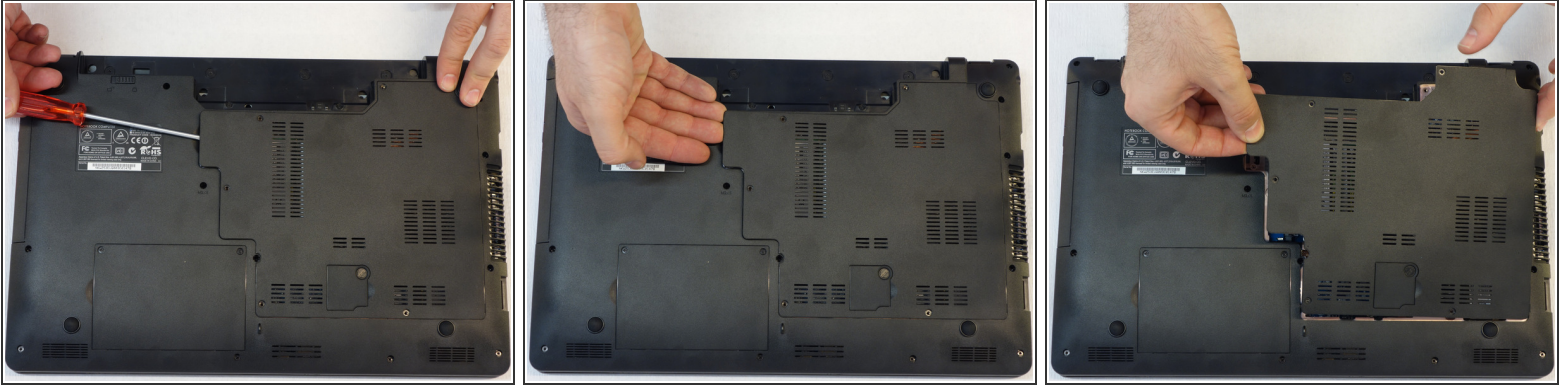


- Screwdriver a few millimeters under the cover slide so that it can then be handled with the fingers.
- Cover now lifting carefully.
- Attention! Ventilatorkabel separate so that the cover can be removed completely (see next step).

Step 4

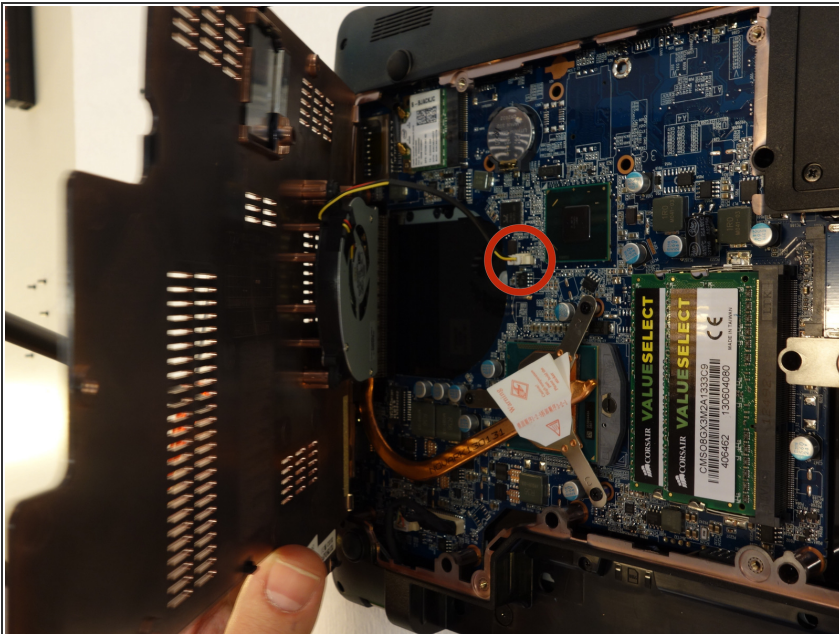


- Since the ventilátor is fixed under the cover, be power cord must first be separated so that the cover can then be completely removed.

Step 5 — processor

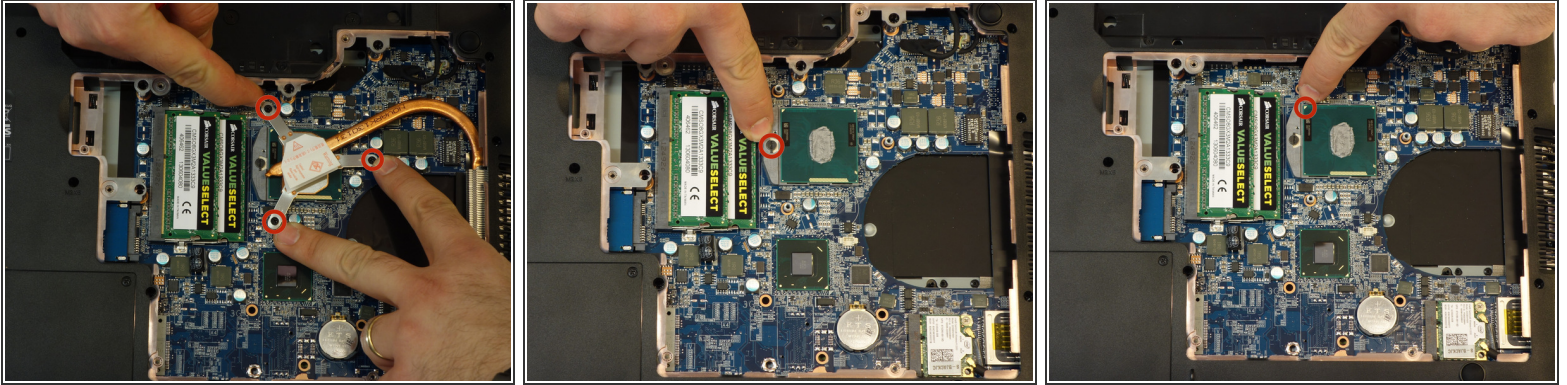

- With the screwdriver Phillips # 1, unscrew the 3 screws securing the processor heatsink going.
- Position of the triangular mark notice because this determines the positioning of the processor when reassembling.
- Unlock now the coupling system of the processor with a classic screwdriver.
- Make sure that you do not remove the heat dissipating paste between the processor and heatsink, as only then a proper cooling of the processor is guaranteed.

Step 6

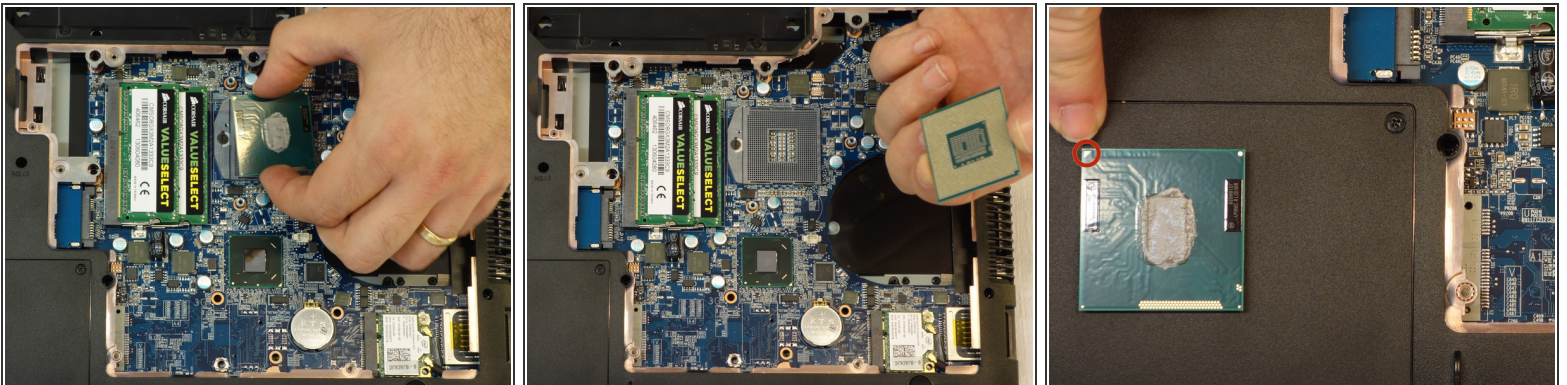

- Carefully separate the processor from its holder.
- Now insert the processor taking into account the position of the triangle to the side.

Pour le remontage, suivez les instructions dans l'ordre inverse

